

DITCH INSPECTION FORM

DITCH NAME Miller F.

TYPE SWCD Group

OVERALL RATING

RECONST DATE 1966

LAST EXC 1987

5 EXCELLENT

4 GOOD

3 FAIR

2 POOR

1 VERY POOR

0+00 STA 27 Carroll

LENGTH 4220'

ASSESSMENT BASE \$1617.44

CURRENT CONDITION AND PLAN OF ACTION

SEDIMENT	<input type="checkbox"/> GOOD CONDITION <input type="checkbox"/> BOTTOM EXCAVATION 5-10 YRS <input checked="" type="checkbox"/> NEEDS EXCAVATION SOON	Average sediment 1.5'-2.0', design grade 0.07%
BANK STABILITY	<input checked="" type="checkbox"/> BANKS GOOD <input type="checkbox"/> BANKS STEEP LESS THAN 1.5:1 <input type="checkbox"/> RIP RAP NEEDED	
OUTLET PIPES	<input type="checkbox"/> GOOD CONDITION <input type="checkbox"/> NEED REPAIR	
VEGETATION	<input type="checkbox"/> GOOD CONTROL <input type="checkbox"/> NEEDS MOWING <input checked="" type="checkbox"/> BRUSH <input type="checkbox"/> CATTAILS <input type="checkbox"/> PHRAGMITIES	Light Brush
FUTURE	2020	2021

Original project stopped at Camp Perry Western Road and did not go to the next available outlet which was Rusha Creek or at least to a backwater elevation at Genzman Road 3000' to the north. Approximately 2.0 feet of water is sitting at the culvert at Camp Perry Western. A bottom excavation will free up the upper end but the lower end will receive no benefit. This may require a meeting of the landowners to see if there is any interest in pursuing work north of Camp Perry Western Rd as a private excavation. Need to do some survey work north of Camp Perry Western to see how much work is required. The landowner to the north has expressed interest in an excavation. About 50% of the project has good filter strips, which has definitely helped. This ditch requires only periodic mowing or spraying. It provides decent drainage considering the area. If possible do survey in 2019 to look at excavation

DATE INSPECTED: 3.6.2018

INSPECTED BY: Mike Gargac