

DITCH INSPECTION FORM

DITCH NAME Salem carroll Rd ditch

TYPE 6131

OVERALL RATING

RECONST DATE 1960

LAST EXC 2010 partial

5 EXCELLENT

4 GOOD

3 FAIR

2 POOR

1 VERY POOR

0+00 STA 32 Salem

LENGTH 5302'

ASSESSMENT BASE \$1388.23

CURRENT CONDITION AND PLAN OF ACTION

SEDIMENT	<input type="checkbox"/> GOOD CONDITION <input type="checkbox"/> BOTTOM EXCAVATION 5-10 YRS <input checked="" type="checkbox"/> NEEDS EXCAVATION SOON	1.3-1.5' in areas
BANK STABILITY	<input type="checkbox"/> BANKS GOOD <input checked="" type="checkbox"/> BANKS STEEP LESS THAN 1.5:1 <input type="checkbox"/> RIP RAP NEEDED	reconstructed area along Salem Carrol good but steeper along SR19
OUTLET PIPES	<input type="checkbox"/> GOOD CONDITION <input type="checkbox"/> NEED REPAIR	
VEGETATION	<input type="checkbox"/> GOOD CONTROL <input type="checkbox"/> NEEDS MOWING <input type="checkbox"/> BRUSH <input type="checkbox"/> CATTAILS <input type="checkbox"/> PHRAGMITIES	
FUTURE	2020	2021

Road ditch on the south side of Salem Carroll rd starting approx 1000' east of Toussaint Portage Rd and flowing east to SR 19 then south on the west side of SR 19 to Lacarpe Creek. The part of the Salem Carroll Rd section was reconstructed and moved over. Some yard areas were closed. Very flat grade with standing water. There are no filter strips on the agricultural ground along Salem Carroll and the previous farmer caused quick sedimentation. The SR 19 section has steep side slopes with no road berm. Most of the ditch is at a minimum to no grade and capacity. The Ottawa County Engineer is looking to do a ditch bottom excavation on the Salem Carroll Rd section. Unless the SR 19 section is done the full benefit will not be realized. Looking at a 2018 excavation and to see if ODOT will do the section along SR 19.

DATE INSPECTED: 2.1.2018

INSPECTED BY: Mike Gargac